

SERVICE BULLETIN

Two-Ball Pump Changes

LOWER PUMP ENDS AFFECTED: 66300-X



RELEASED: 4-9-99
REVISED: 1-10-12
REV: 00
BULLETIN: #3-99
FORM: 4319-2

Changes affect models built after 3-1-99.

HARDENED PISTON AND REDESIGN WITH ADDITIONAL WIPING V-PACKING.

The following changes were made to 66300-X Lower Pump End.

- 1) 94231 Piston replaced by new design 94929 Piston.
- 2) Add 94928 Gasket.
- 3) 94251-1 Guide Ring removed.
- 4) 93455-2 or 93455-4 Packing added as appropriate for model.

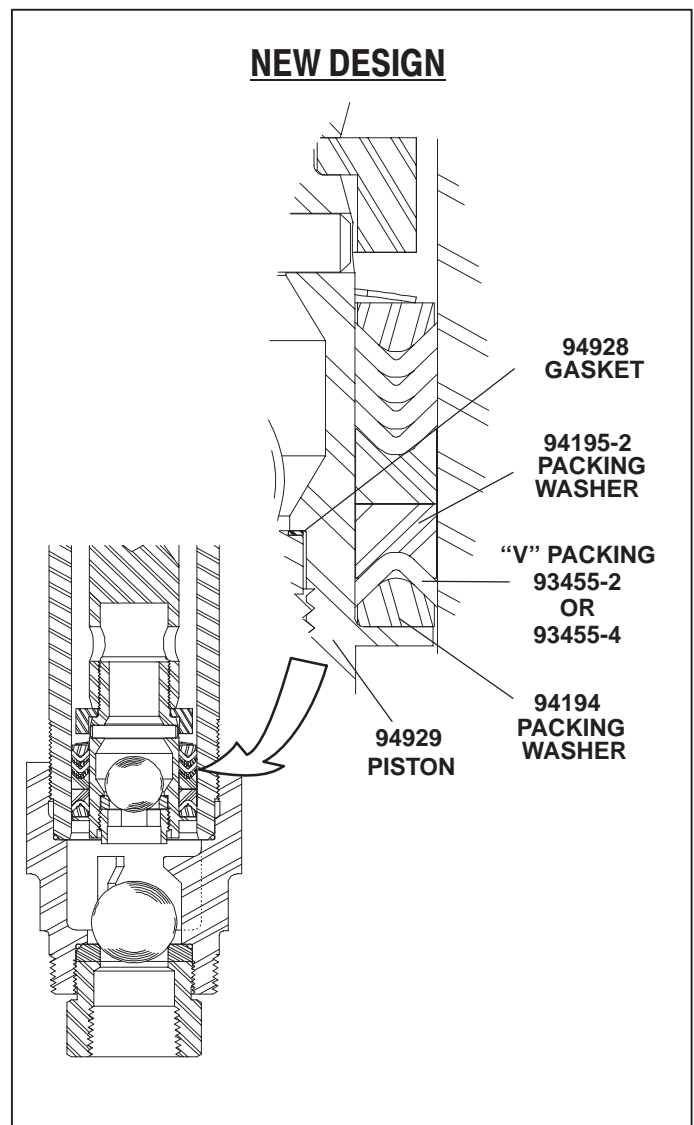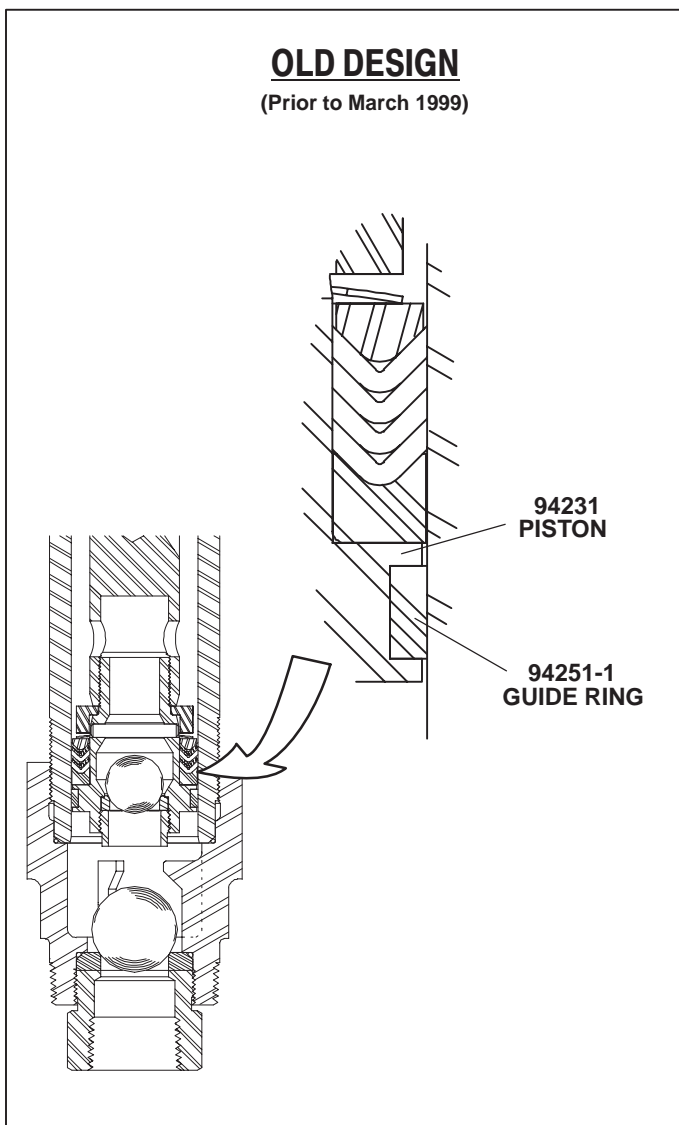

PN 97999-1598

INGERSOLL RAND COMPANY LTD
209 NORTH MAIN STREET – BRYAN, OHIO 43506

☎ (800) 495-0276 • FAX(800) 892-6276

© 2012 CCN 46735056

www.ingersollrandproducts.com

ARO  **Ingersoll Rand**
Industrial Technologies