


49050 SERVICE KIT INSTALLATION

1. NOTE: It is important to install all parts contained in this service kit, as instructed below.
2. 49050 Service Kit contains the following parts:
 - 48761-1 Fitting (90°)
 - 48765-1 Fitting (3 req'd)
 - 48766-1 Tubing (2 req'd)
3. Disconnect air supply to workstation before attempting to replace service parts.
4. Remove and discard bushing (11), fitting (12) and tubing (13), replacing with 48761-1 90° fitting and 48766-2 tubing.
5. Remove and discard fitting (18), replacing with 48765-1 fitting. Connect new tubing (13) to new fitting (18).
6. Remove and discard fitting (19) and tubing (40), replacing with 48765-1 fitting and 48766-2 tubing.
7. Remove and discard fitting (34) and replace with 48765-1 fitting. Connect new tubing (40) to new fitting (34).
8. Connect air supply to workstation.

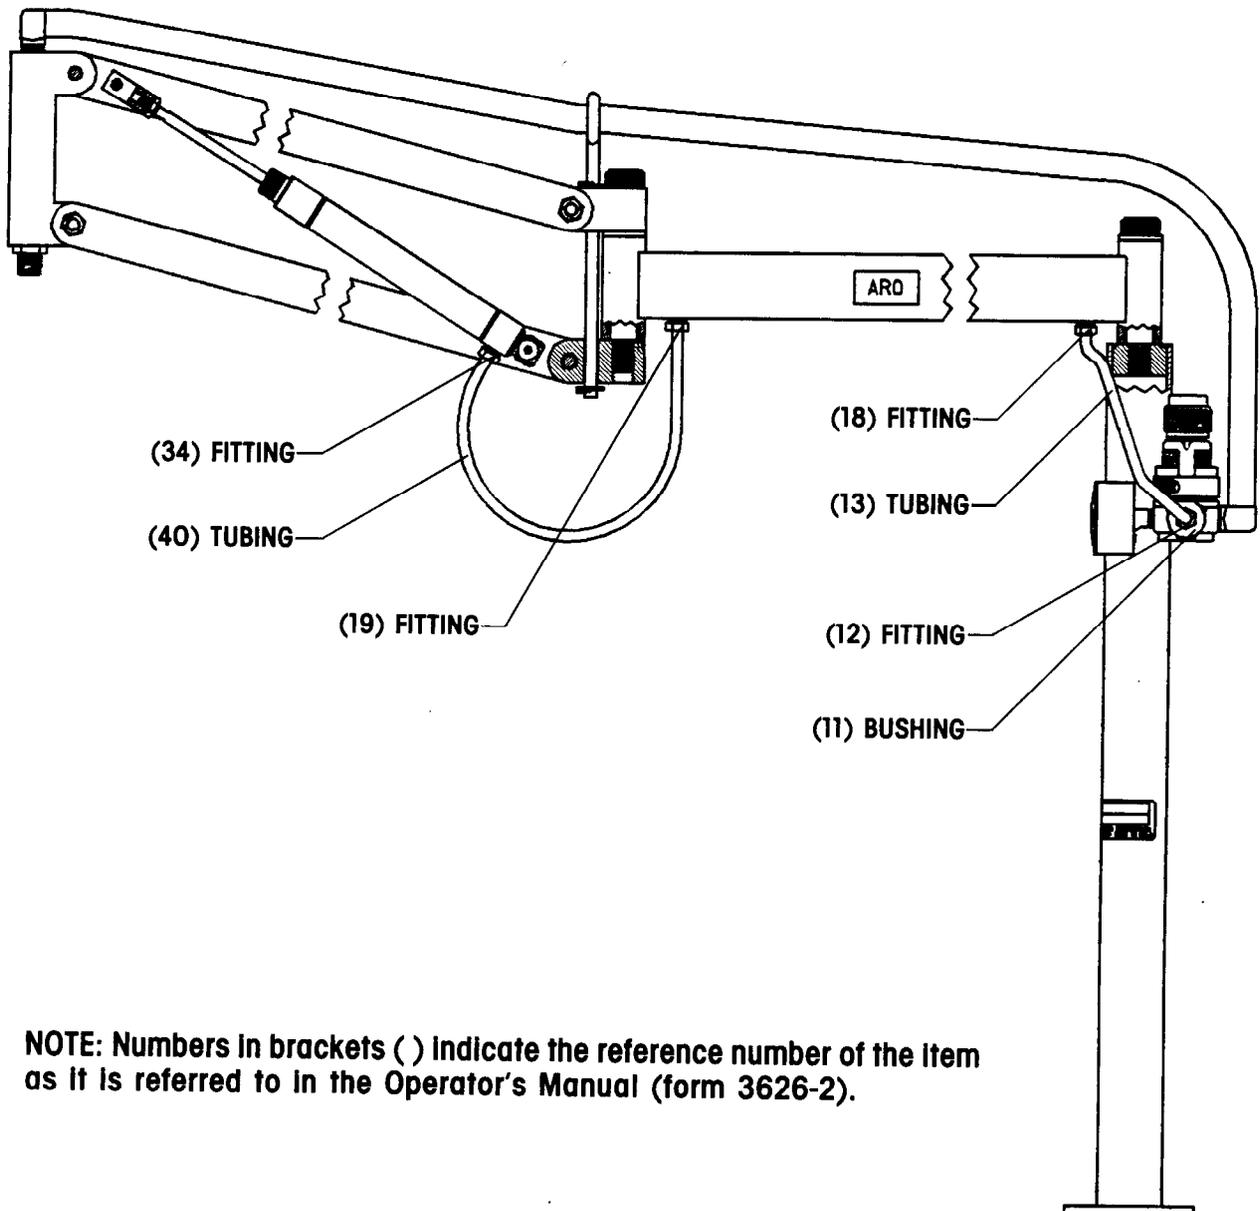

NOTE: Numbers in brackets () indicate the reference number of the item as it is referred to in the Operator's Manual (form 3626-2).